

OPERATING MANUAL

PRO 211-x

PRO 215-x

Differential
manometers



Contents

1	General information	3
1.1	Safety information.....	4
2	Overview	5
2.1	Scope of delivery	5
3	Description	6
4	Preparing the instrument	8
5	Measurement mode	10
5.1	Hold function.....	11
5.2	Rel function	11
5.3	Reset of the statistical values	12
6	Configuration	13
6.1	Menu structure.....	14
6.2	Configuring a parameter	15
7	Measurement basics	16
8	Measurement adjustment	16
9	Logging (PRO 215-x only)	17
9.1	Viewing the logged data.....	17
9.2	Deleting the logged data.....	17
10	Serial communication	18
11	Battery management	19
12	Maintenance	20
12.1	Cleaning.....	20
12.2	Storage	20
12.3	Disposal.....	20
13	Technical specifications	21
14	Accessories	23

1 General information

Read this document carefully and familiarize yourself with the operation of the device before using it. Keep this document ready to hand and in the immediate vicinity of the device so that it is always available to the personnel/user in case of doubt.

Only technically qualified persons are permitted to carry out commissioning, operation, maintenance and decommissioning. The personnel must have carefully read and understood the operating manual before starting any activity.

Legal notices

- For your safety, use only the manufacturer's original spare parts and accessories. We assume no responsibility for the use of other products and any resulting damage.
- The user must have adequate knowledge of the measuring process and use of the measurements. The user is liable in case of damage/danger due to misinterpretation of the measurements as a result of inadequate knowledge.
- The liability and warranty of the manufacturer for product damages and consequential damages are voided in the event of misuse, failure to comply with these operating instructions, failure to observe safety warnings, assignment to inadequately qualified technical personnel and arbitrary modifications of the device.
- No part of this document may be reproduced, modified or translated without prior written permission of the product manufacturer. In case of ambiguity between different language versions of this document, the English version applies.
- This document does not create any legally binding obligations for the product manufacturer. All legally binding obligations are included only in the General Terms and Conditions of Sale.

Correctness of content

- This document was checked for corrected contents and is subject to a continuous updating process. This does not rule out potential errors. In the event that errors are discovered or in case of suggestions to make this document more user-friendly, please inform us via the contact information given in this document.
- We reserve the right to change the product specifications and the contents of this document without prior notice.

Explanation of symbols used

Danger!

Warning of danger that could result in death, serious bodily injury, or serious property damage if not observed.

Caution!

Warning of potential danger or harmful situation that may cause damage to the device or the environment if not observed.

Attention!

Action that may have a direct effect on operation or may cause an unexpected behavior.

[▶ p.4] Reference to the indicated page number.

1.1 Safety information

Fault-free operation and operational safety of the device can only be guaranteed if the general safety requirements and the specific safety requirements in this document are observed.

Do not use the device in climatic conditions other than those specified in this document.

Do not use the device in places with:

- Rapid ambient temperature variations that may cause condensation.
- Direct vibrations / shocks to the device.
- High-intensity electromagnetic fields or static electricity.

Intended use

The device is a handheld meter designed for measuring differential pressure in air and non-aggressive dry gases.

Foreseeable misuse

If the following notices are disregarded, personal injury or death, as well as property damage can occur.

Danger!

- Do not use in safety / emergency stop devices!
- Not suitable for use in hazardous areas (Ex-environments)!
- Not suitable for diagnostic or other medical purposes on patients!
- Not suitable for SIL (Safety Integrity Level)!
- The device is not suitable for contact with food!
- Not suitable for children!
- Do not use as PPE (Personal Protection Equipment).

Caution!

Do not use if:

- There is visible damage to the device.
- The device is not working as expected.
- The device has been stored under unsuitable conditions for an extended period.

On suspicion that the device can no longer be operated without danger, it must be decommissioned and prevented from recommissioning with appropriate labelling.

In case of doubt, send the device to the manufacturer for repair or maintenance.

Attention!

Remove batteries to prevent leakage if the device is stored at a temperature above 50 °C or not used for an extended period of time.

2 Overview

PRO 211-x and **PRO 215-x** are professional handheld differential pressure meters. **PRO 215-x** also has data logging capabilities.

The meters have an internal digital differential pressure sensor. Offset and slope user corrections allows compensating any possible sensor drift with time, for the best measuring accuracy.

Supplied with universal barbed pressure ports for connecting 4 and 6 mm inner diameter hose. The pressure ports are screwed to the meter by a standard G 1/8 thread, allowing the user to change them with a different type of port, if necessary, to fit his specific needs.

Detection of minimum, average and maximum values. The user can reset the statistical info to start a new statistical calculation.

Alarm thresholds can be set, to warn the user when the set values are exceeded.

The HOLD feature allows freezing the measurement on display, while the REL feature allows showing the measurement against a value determined by the user.

The meter can be connected to a PC via the USB-C port, for data acquisition in COM interface mode. The logger version PRO 215-x can operate in Mass storage mode, for viewing or downloading the files stored in the internal memory or connecting to the **ProXware** application software.

Powered by 4 standard AA size alkaline batteries. For permanent operation, the instruments can also be powered via the USB-C port by a standard 5 Vdc standard power adapter or suitable power bank.

The configurable auto-off feature and LCD backlight level allows for more energy saving options.

2.1 Scope of delivery


PRO 211-x is supplied with:

- Quick start guide
- 4 alkaline batteries, AA size
- 2 PVC hoses, inner Ø 4 mm, outer Ø 6 mm
- Test report

PRO 215-x is additionally supplied with a USB cable.

The **ProXware** application software is downloadable from Senseca website.


3 Description

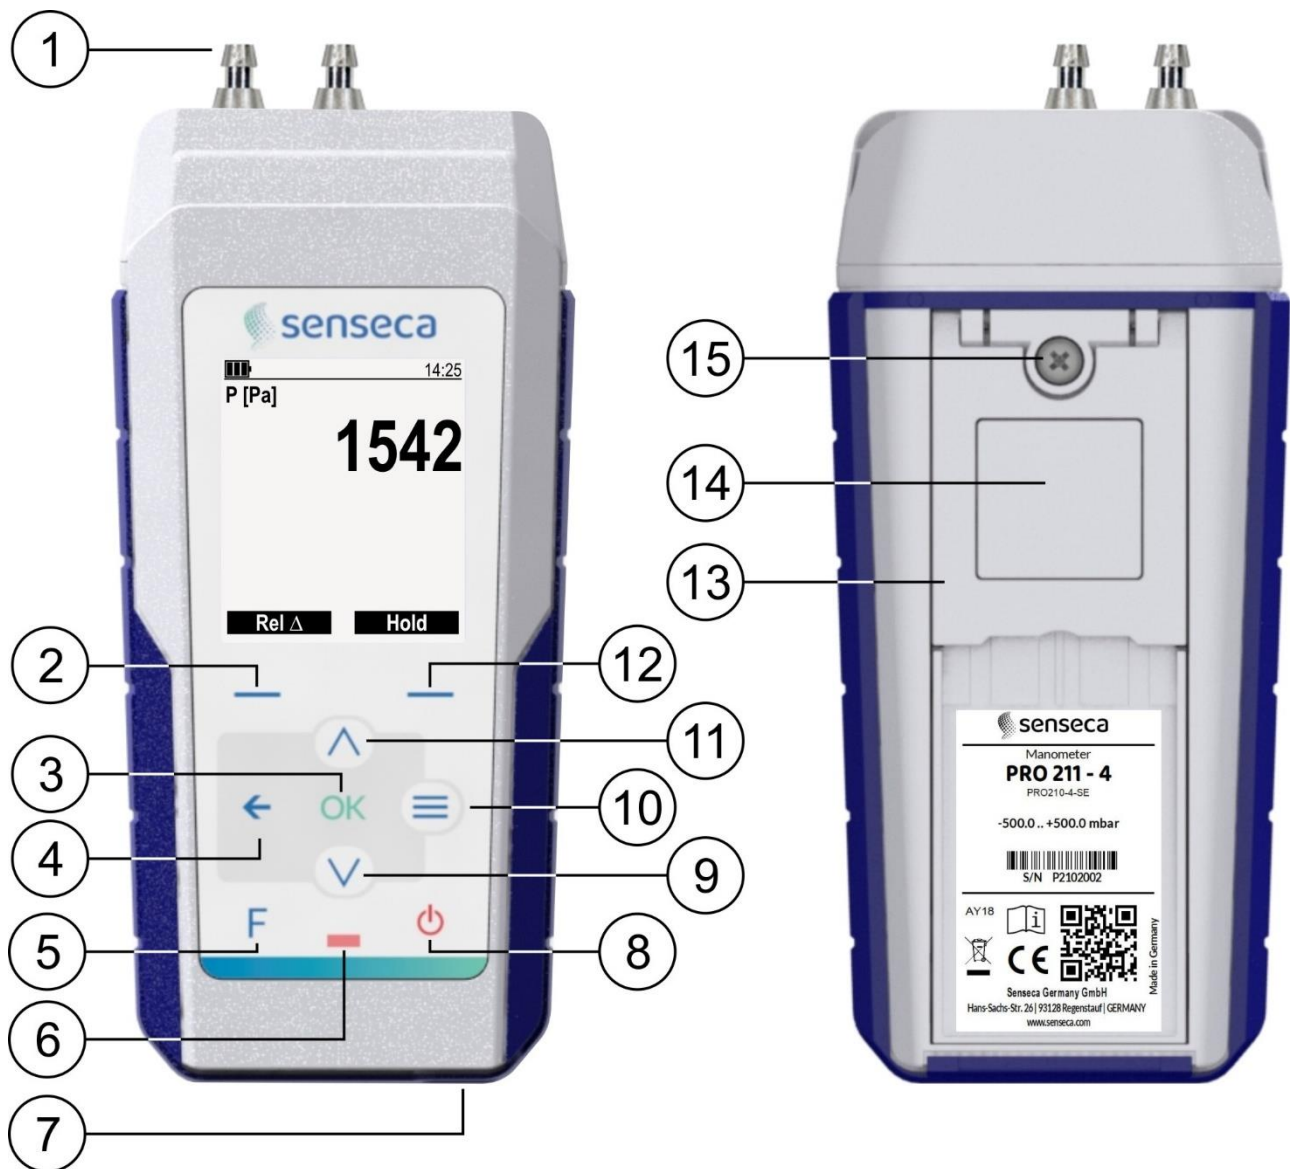

1. Pressure ports.
2. Left function key: runs the command shown at the bottom left on display.
3. **OK** key: confirms the selection.
4. **←** key: in measurement display cycles through the various available visualization modes; in the menu goes up one level, cancelling any unconfirmed changes.
5. **F** key: reserved.
6. Status LED.
7. USB-C port for connecting the PC or the external power supply.
8. **ON/OFF** key: turns the instrument on/off.
9. **Down arrow** key: scrolls down in a list or decreases the value of a parameter.
10. **MENU** key: enters the configuration menu.
11. **Up arrow** key: scrolls up in a list or increases the value of a parameter.

12. Right function key: runs the command shown at the bottom right on display.
13. Foldable stand: pull to open the stand.
14. Magnet, for attachment to metal surfaces.
15. Battery compartment fixing screw.

DISPLAY

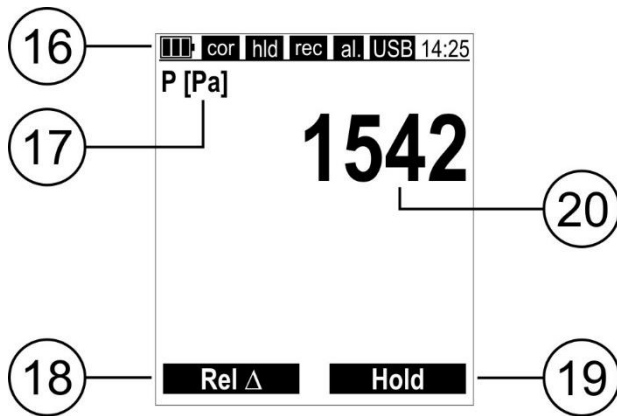

Symbols in the status bar:

	Battery charge level
	External power supply connected
	Measurement correction applied
	Hold function active
	Logging in progress
	Measurement in alarm
	USB port connected to PC
14:25	Current time


16. Status bar.
17. Measured parameter and unit of measurement.
18. Function corresponding to the left function key.
19. Function corresponding to the right function key.
20. Measured value.

4 Preparing the instrument

Power supply

The instrument is powered by 4 AA size alkaline batteries, already assembled in the device as standard.

If for some reason (e.g., shipping rules) the batteries are not already assembled, unscrew the battery cover fixing screw and remove the cover, then insert the batteries as shown below.

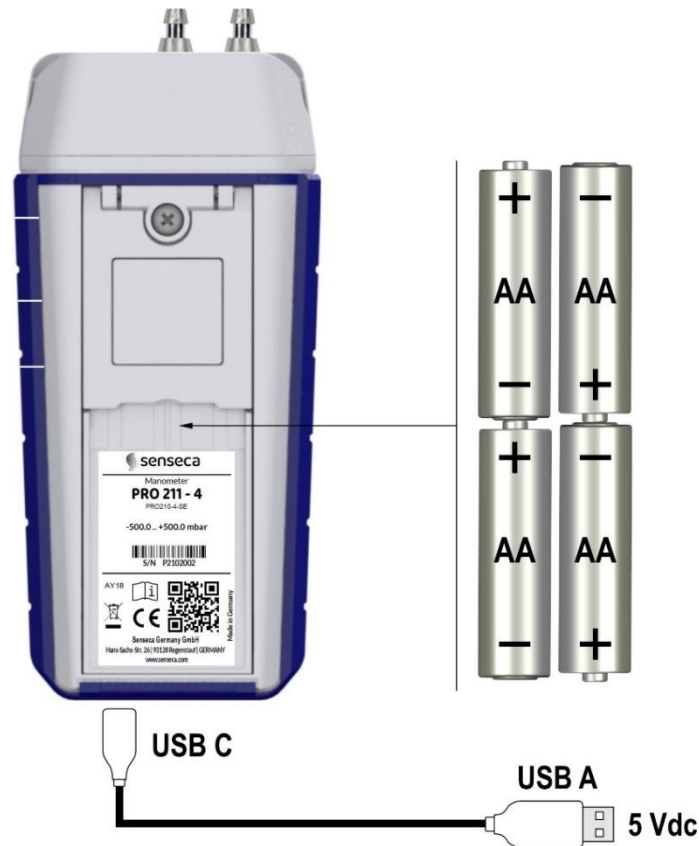

The instrument can also be powered via the USB-C port by a 5 Vdc standard power adapter or power bank. If a power bank is used, make sure it is of appropriate capacity and does not have the auto-shutdown function when the current draw is very low (for example, suitable power banks are those in the Varta Power Bank Energy series).

Pressure ports connection

The instrument is supplied as standard with universal barbed pressure ports for 4 and 6 mm inner diameter hose. Connect the hoses respecting the +/- polarity according to the system to be monitored.



 **Attention!**

Use hoses with a diameter compatible with the pressure ports. The inner diameter of the hose should not be too large to avoid pressure loss and should not be too small to avoid mechanically forcing the ports when inserting the hose.

 **Caution!**

- Use hoses suitable for the pressure to be measured.
- It is recommended that the hoses are not under pressure during connection.
- It is recommended to secure the hoses to the pressure ports with hose clamps when measuring pressures above 1 bar. **GDZ-18** hose clamp is available as optional accessory.


The pressure ports are interchangeable. It is possible to unscrew the ports to replace them with ports of a different type, provided they have G 1/8 thread. When tightening the ports, use a suitable tool and observe the maximum torque of 2 Nm.

5 Measurement mode


To switch on the instrument, press the ON/OFF key. After a few seconds, the instrument displays the measured value.

Note: when the instrument is turned on for the first time, it automatically enters the menu displaying some factory settings (language, date/time, etc.); press repeatedly OK to accept the proposed settings or change them as indicated in the Configuration chapter [▶ p.13].


By repeatedly pressing the ← key, measurements can be displayed in different formats:

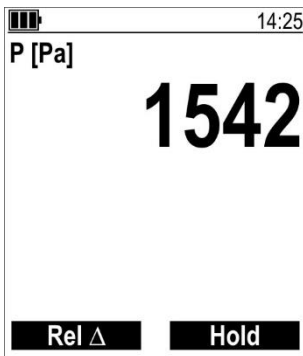


Parameter displayed in large format.

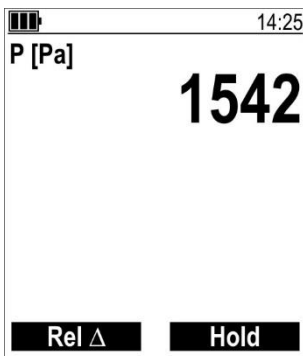


Parameter displayed in medium format.

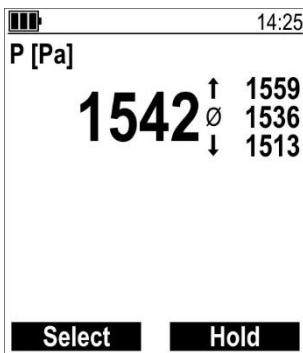

Parameter displayed in medium format with indication of maximum (↑), average (∅) and minimum (↓) values.

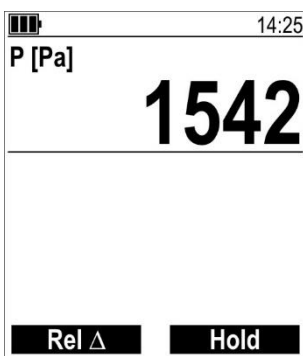

One parameter displayed in large format and the remaining in small format.

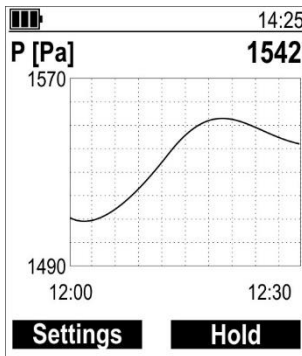

Parameter displayed numerically and graphically.

To change the unit of measurement, see the Configuration chapter [▶ p.13].

5.1 Hold function


The **Hold** function, which can be activated/deactivated by pressing the right function key, freezes the current measurement value on the display.

The function activation is highlighted by the **hld** symbol in the status bar of the display.

5.2 Rel function

The **Rel** function displays the relative measurement against a reference value, consisting of the measurement value at the time the function is activated.

To activate the relative measurement, press the left function key (**Rel Δ**), the measurement is highlighted in negative, then press the left function key (**Δ on**). The symbol **Δ** and the reference value appear on display.

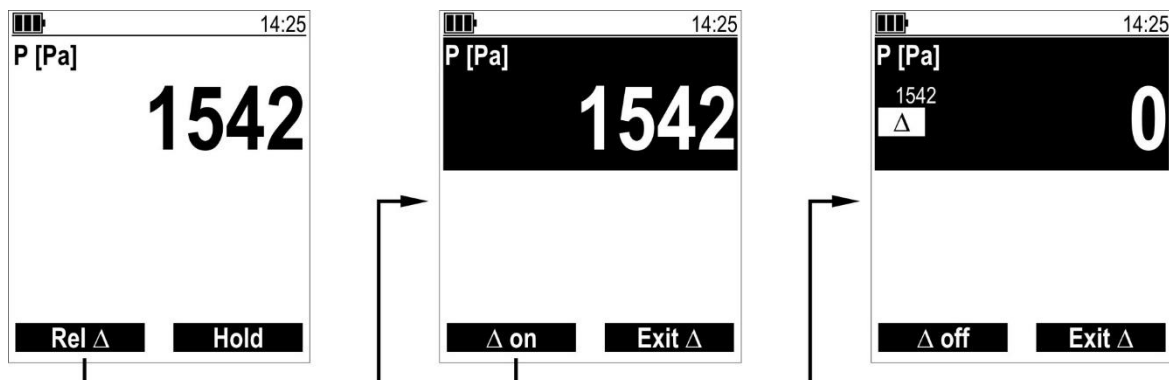

To disable the relative measurement, press the left function key (**Δ off**) again.

By pressing the right function key (**Exit Δ**), the instrument exits the relative measurement enable/disable (**Δ on/off**) mode.


The **Rel Δ** command is not available:

- in the screen with the statistical values;
- in the screen with the graph;
- while logging.

5.3 Reset of the statistical values

To reset the statistical values, press the left function key (**Select**) in the measurement screen with the maximum/medium/minimum values, the measurement is highlighted in negative, then press the left function key (**Clear**).


To exit the statistical values reset mode, press the right function key (**Exit**).

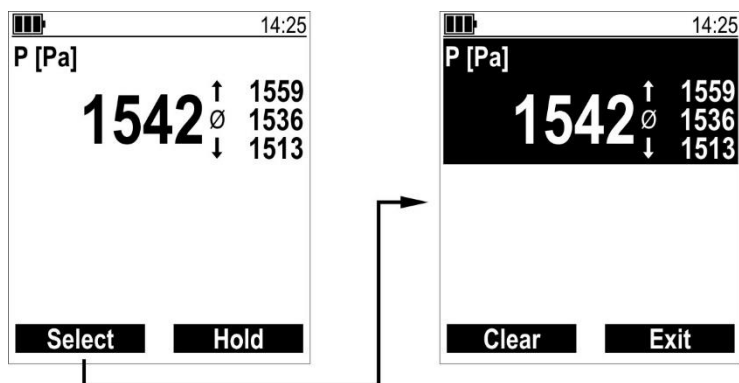

6 Configuration

Press the **MENU** key to enter the configuration menu.

The menu is structured in levels. The current level is indicated by the number of overlapping bars in the menu header:

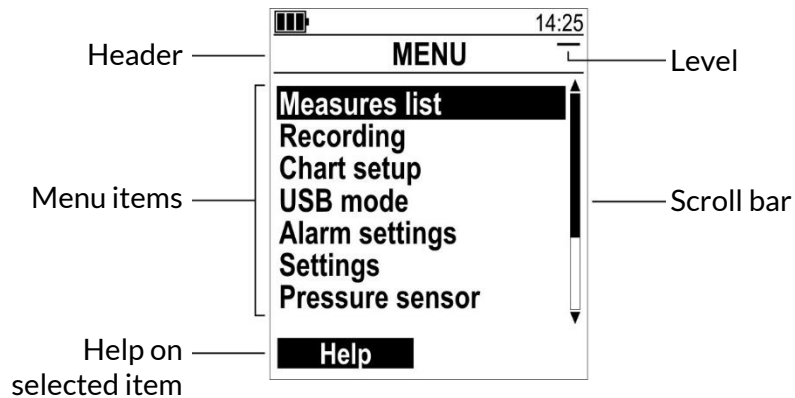

Use the **down/up arrow** keys to select an item, press **OK** to confirm.

The presence of the scroll bar indicates that there are additional items available beyond those displayed.

The left function key (**Help**) provides a description of the selected item. If the help function is entered, press the left function key (**Help off**) again to exit.

! Attention!

It is not possible to access the menu if the instrument is logging.

6.1 Menu structure

The menu structure is shown below; each item is preceded by the level according to the bar symbology shown on the display.

MENU	DESCRIPTION
– Measures list	Selection of the quantities to display and log
– Recording	<i>Only PRO 215-x</i>
= Start recording	Logging start
= Set interval	Setting of logging interval: 1/2/5/10/15/30 s, 1/2/5/10/15/30 min, 1 h
– Chart setup	Setting of the measurement graphical display
= Channel select	Selection of parameters to be displayed graphically (selectable from those enabled in the "Measures list" menu)
= Chart interval	Chart measurement interval: 1/2/5/10/15/30 s, 1/2/5/10 min
– USB mode	Configurable only in PRO 215-x between COM interface (for logging and serial communication) or Mass storage (for viewing logging files from PC). In PRO 211-x the mode is always COM interface.
– Alarm settings	Type of alarm signaling: Off, acoustical (buzzer) and/or optical (flashing backlight and red flashing status LED)
– Settings	
= Device info	Displaying of instrument info (model, S/N, FW revision, ...)
= Backlight	Backlight configuration
≡ BL activation	Backlight duration: Off, 5 s, 30 s, 1 min, always On
≡ BL intensity	Backlight intensity: Low, Medium, High
= Auto-off	Auto-off setting: Off, 30 min, 1/2/4/6/12 h
= Date & time	Setting of date and time (yyyy-mm-dd hh:mm:ss)
= Time zone	UTC or CET time zone setting
= Language	Selection of the menu language
= Dark mode	Black background enabling/disabling
= Factory reset	Reset to factory settings
– Pressure sensor	Measurement settings
= Measures units	Setting of the unit of measurement <i>The units available depend on model (see technical specifications)</i>
= Alerting	Alarm thresholds enabling/disabling
= Min. alarm (*)	Lower alarm threshold (alarm if measure < threshold)
= Max. alarm (*)	Upper alarm threshold (alarm if measure > threshold)
= Hysteresis (*)	Thresholds hysteresis
= Correction	Measurement adjustment
≡ Zero point	Offset adjustment
≡ Gradient	Slope adjustment
= Probe info	Information on the sensor

(*) The item does not appear if "Alerting" is set to "Off"; to display the item, first select a measure/channel to associate the alarm with.

To go back up one level within the menu, press the ← key. The **MENU** key allows exiting the menu directly and return to measurement mode from any level (except from parameter

setting screens, from which you can exit only with ←).


6.2 Configuring a parameter

Configuring a parameter may require choosing an option from those proposed, or setting a numerical value.

Configuring a parameter by choosing an option from those proposed:

The current setting is marked by the check mark. To change it, choose an option with the **down/up arrow** keys, then press **OK** to confirm.


Pressing the ← key it is possible to exit by canceling changes not yet confirmed.

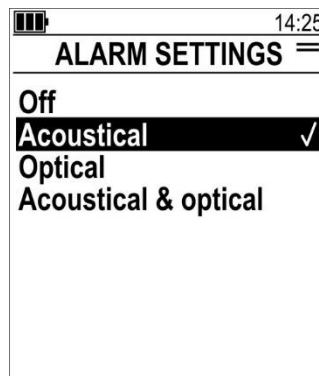

Configuring a parameter by setting a numerical value:

Select the various digits using the function keys (< >). To change a digit, use the **down/up arrow** keys. When finished, press **OK** to confirm the value.

Pressing the ← key it is possible to exit by canceling changes not yet confirmed.

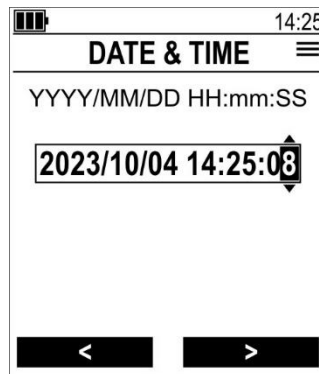

7 Measurement basics

The instrument internal pressure sensor detects the difference between the pressure applied to the "+" input and the pressure applied to the "-" input.

Before taking the measurement, check the need to perform zeroing by leaving the pressure inputs open (see next chapter for measurement adjustment).

By connecting only the "+" input and leaving the "-" input open, the pressure difference from the ambient pressure (relative pressure) can be measured.



Caution!

- Do not exceed the maximum overpressure specified, the sensor may be damaged.
- The sensor is suitable for measurement in air and non-aggressive dry gases: do not use for measurement in corrosive gases.
- Avoid performing measurements in the presence of high-frequency sources, microwaves or strong magnetic fields.
- Connect the hoses to the instrument without forcing or bending the pressure ports.

8 Measurement adjustment

The measurement can be adjusted by setting the following parameters, available in the **Pressure sensor** → **Correction**:

- **Zero point:** adds an offset (P_{offs}) to the measurement.

$$\text{Displayed value} = \text{Measured value} + P_{\text{offs}}$$

- **Gradient:** applies a percentage correction ($C_{\text{slope}}\%$) to the measurement. Zero indicates no correction.

$$\text{Displayed value} = (\text{Measured value} + P_{\text{offs}}) * (1 + C_{\text{slope}}\% / 100)$$

If a measurement correction is applied by setting a value other than zero for the "Zero point" and/or "Gradient" parameters, the **cor** symbol appears on the display.

9 Logging (PRO 215-x only)

The logging function stores in the memory of the instrument the detected measurement, along with the date and time of each sample. The data are stored in **CSV** format.

Logging is automatic according to the set interval. To start logging, select the **Start recording** item from the **Recording** menu.

Attention!

- To use the logging function, the **USB mode** menu item must be set to **COM interface**.
- The Logging function records only the quantities enabled in the measurement screens. Before starting logging, make sure that all quantities of interest are enabled.

By selecting "Start recording," the instrument automatically exits the menu. It is not possible to access the menu during logging.

The logging activation is highlighted by the **rec** symbol in the status bar of the display. During logging, the status LED briefly flashes green every 5 seconds.

With logging active, in the measurement screens the left function key assumes the function of **Stop** logging.

During logging, the instrument auto-off is disabled.

9.1 Viewing the logged data

The instrument can be connected to the PC via a standard USB-C cable. The instrument is viewed by the PC as a mass storage device containing the various log files in CSV format.

Attention!

- For viewing files from PC, logging must be off and the **USB mode** menu item must be set to **Mass storage**.

The files can be opened with any standard software capable of reading CSV files, or, the **ProXware** application software can be used.

9.2 Deleting the logged data

The log files can be erased from the PC using a file manager.

10 Serial communication

Serial commands can be sent to the instrument, to read the instrument information and the measurements.

To send serial commands to the instrument, the **USB mode** menu item must be set to **COM interface**.

In the serial communication software used ⁽¹⁾, the PC COM port number to which the instrument is connected has to be set.

Recommended communication parameters:

- Baud rate = 115200
- Data bits = 8
- Stop bits = 1
- Parity = None

The full list of commands supported by the model, with their description, is obtained by sending the following command:

GetCommandList: 0<CR><LF>

<CR> = Carriage Return

<LF> = Line Feed

Between the characters ":" and "0" of the command there is a space.

All command strings sent to the instrument must be terminated by the <CR><LF> control characters.

¹ Any standard serial communication software, e.g., "HTerm", can be used.

11 Battery management

If the external power supply is not connected, the battery symbol on the display indicates the battery charge level.

If the battery charge is insufficient to ensure a correct measurement, the instrument turns off. The data remains stored even with low batteries.

In case of discharged batteries it is necessary to replace the batteries: unscrew the battery cover fixing screw and remove the cover, take out the exhausted batteries and insert 4 new AA size alkaline batteries [► p.8], then screw the cover back on.

Attention!

If you plan to use the instrument on battery power alone, make sure the charge is sufficient to complete the measurements.

Tips:

To increase the battery autonomy, it is possible to reduce the brightness of the backlight and/or enable the instrument auto-off (see Configuration chapter [► p.13]).

Danger!

- Do not short-circuit the batteries, they may explode with serious risk to people!
- Do not expose the batteries to high temperature!
- Do not throw the batteries into fire!

Caution!

Disposal: Dispose the exhausted batteries in the appropriate bins or deliver them to authorized collection centers. Comply with current regulations.

12 Maintenance

It is recommended to perform a calibration check of the instrument annually at accredited laboratories.

12.1 Cleaning

Do not use aggressive cleaning agents or incompatible with the materials indicated in the technical specifications. For cleaning, use a soft dry cloth or slightly dampened with clean water.

12.2 Storage

It is advisable to remove the batteries if the product is stored for a long time.



Caution!

Do not store the product where:

- Humidity is high.
- The product is exposed to direct sunlight.
- The product is exposed to a source of high temperature.
- There are strong vibrations.
- There is vapor, salt and/or corrosive gas.

12.3 Disposal



Electrical and electronic equipment marked with specific symbol in compliance with 2012/19/EU Directive must be disposed of separately from household waste. European users can hand them over to the dealer or to the manufacturer when purchasing a new electrical and electronic equipment, or to a WEEE collection point designated by local authorities. Illegal disposal is punished by law.

Disposing of electrical and electronic equipment separately from normal waste helps to preserve natural resources and allows materials to be recycled in an environmentally friendly way without risks to human health.

13 Technical specifications

Measurement specifications

Measuring range	PRO 21x-2: ±20.00 hPa PRO 21x-3: ±200.0 hPa PRO 21x-4: ±500.0 hPa PRO 21x-5: ±2000 hPa
Resolution	PRO 21x-2: 0.01 hPa PRO 21x-3: 0.1 hPa PRO 21x-4: 0.1 hPa PRO 21x-5: 1 hPa
Accuracy	±0.15 %FSS ^(*) ± 1 digit typ. @ 25 °C ±1.5 %FSS ± 1 digit max.
Measurement rate	4 meas./s
Overpressure limit	PRO 21x-2: ±100 hPa PRO 21x-3: ±1000 hPa PRO 21x-4: ±2000 hPa PRO 21x-5: ±3500 hPa
Temperature drift (ref. 25 °C)	±0.002 %FSS/K typ.
Long-term drift	±1 %FSS/year max.
Compatible media	Air and non-aggressive dry gases

(*) FSS = 2 x full scale pressure

Units of measurement

	Pa	hPa	kPa	bar	mbar	in Hg	mm Hg	in H ₂ O	mm H ₂ O	psi	Kgf/cm ²
PRO 21x-2	√	√	√	√	√	√	√	√	√		
PRO 21x-3	√	√	√	√	√	√	√	√	√	√	
PRO 21x-4	√	√	√	√	√	√	√	√	√	√	
PRO 21x-5		√	√	√	√	√		√	√	√	√

General specifications

Input channels	1 differential 2 x universal barbed pressure ports (+/-) for 4 and 6 mm inner diameter hose Interchangeable G 1/8 thread connections
Storage capacity (only PRO 215-x)	Up to 1 million data sets, file system based (CVS files). Each data set includes measurements of all channels and date/time stamp.
Logging type (only PRO 215-x)	Automatic with manual start/stop
Logging interval (only PRO 215-x)	1, 2, 5, 10, 15, 30 s / 1, 2, 5, 10, 15, 30 min / 1 h

Clock	User settable RTC Max. drift 1 min/month @ 25 °C
Display	140 x 160 dot matrix backlit LCD Visible area 42 x 50 mm
User interface	Multilingual
PC connection	USB-C, Mass Storage Device (only PRO 215-x)
Power supply	4 x AA alkaline batteries External 5 Vdc via USB C
Power consumption	20 mA typ.
Battery autonomy	> 150 h typ. continuous operation (backlight off)
Auto power off	Yes, user configurable
Operating conditions	-5...50 °C / 0...85 %RH non-condensing
Storage temperature	-25...65 °C (without batteries)
Protection degree	IP 67 (except pressure inputs) IK 06
Dimensions	170 x 78 x 38 mm
Weight	340 g approx.
Housing material	ABS, TPE (side protection), Polyester (front panel)

14 Accessories

Spare and optional pressure ports:

GDZ-UT



Universal barbed pressure port for 4 and 6 mm inner diameter hose.

Art. No. 479260

Spare part – Included in the scope of supply

GDZ-QC6



Quick coupling pressure port for 4 mm inner diameter hose.

Art. No. 479261

GDZ-ST6



Screw coupling pressure port for 4 mm inner diameter hose.

Art. No. 479466

GDZ-MCF



2.7 mm nominal diameter mini female quick coupling for 4 mm inner diameter hose.

Art. No. 480221

GDZ-MCM



2.7 mm nominal diameter mini male quick coupling for 4 mm inner diameter hose.

Art. No. 479467

Other accessories:

GDZ-01-02



PVC hose 6/4 (6 mm outer Ø, 4 mm inner Ø).
Max. 5 bar at 23 °C.

Art. No. 604158

GDZ-18



Hose clamp for hose 6/4.

Art. No. 601576


GDZ-31-02



PVC hose 8/5 (8 mm outer Ø, 5 mm inner Ø).
Max. 2 bar at 23 °C. Max. 200 °C.

Art. No. 480659

CASE PRO-400

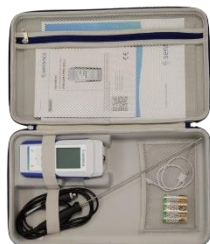

Case for PRO Line.

Recess for one instrument, space for accessories, carrying handle, zipper.

Dimensions: 415 x 245 x 70 mm (W x H x D).

Art. No. 486900

senseca.com



Senseca Germany GmbH
Hans-Sachs-Strasse 26
93128 Regenstauf
GERMANY
info@senseca.com

